


PUMP/MOTOR/TANK ASSEMBLY AP8086/AP8595 FENNER STONE - OBSOLETE

PUMP RELIEF IS SET AT 3500 PSI.

REPLACEMENT PUMP INCLUDES
FITTING KIT (6) AND O-RING KIT (5)

FITTING KIT
FOR USE ON MANUAL
CONTROLLED SYSTEMS.

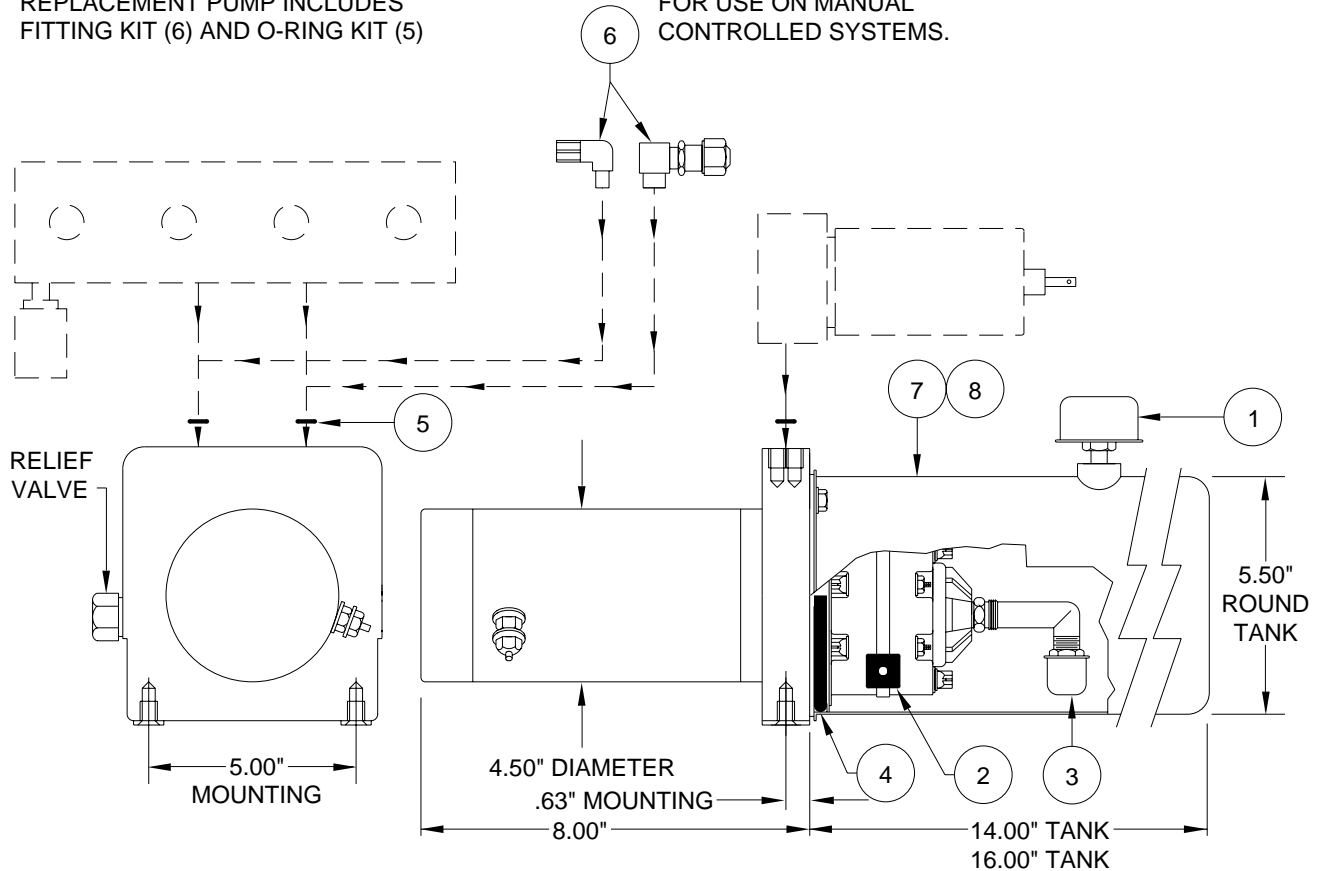

**FENNER STONE
4.50" MOTOR
SUPPLIED 1991 TO 1992**

ITEM	PART	QTY	DESCRIPTION	ITEM	PART	QTY	DESCRIPTION
	AP8086	OBS	POWER UNIT/BMS/1.0 GALLON 4.5" MOTOR	5	**RAP9171	1	SEAL KIT
	AP8595	OBS	POWER UNIT/BMS/1.5 GALLON 4.5" MOTOR	6	RAP0586	1	FITTING KIT (INCLUDES ITEM 5)
1	RAP7876	1	BREATHER CAP / DIPSTICK	7	RP4132	1	TANK 1.0 GALLON 14" X 5.5" ROUND
2	RP3526	1	MAGNET	8	RP3521	1	TANK 1.5 GALLON 16" X 5.5" ROUND
3	RP3525	1	STRAINER				
4	RP3515	1	O-RING TANK				

* CONTACT HWH WHEN REPLACING ONE OF THESE POWER UNITS ON A 610 PUMP/MANIFOLD. IN MIDYEAR 1992 THE PRESSURE AND RETURN PORTS ON TOP OF THE PUMPS WERE CHANGED FROM 0.438" DIA. HOLES TO 1/4" NPT (.54" DIA.) THREADED HOLES. THUS THE O-RING SPOT FACES ON THE BOTTOM OF THE MANIFOLD WERE CHANGED FROM 5/8" DIA. TO 11/16" DIA. TO ALLOW LARGER O-RINGS TO COVER THE LARGER PUMP PORT. REPLACEMENT PUMPS HAVE THE 1/4" NPT PORTS THUS THE MANIFOLD MUST BE CHECKED TO DETERMINE IF IT HAS THE 11/16" DIA. SPOT FACES. IF THE MANIFOLD DOES NOT HAVE THE 11/16" DIA. SPOT FACES IT MUST BE RETURNED TO HWH FOR RE-SPOT FACING.

** RAP9171 O-RING KIT CONTAINS (2) O2-014-9N O-RINGS FOR THE 5/8" SPOT FACE AND (2) O2-015-9N O-RINGS FOR THE 11/16" SPOT FACE.

**MR30.4600
14APR14**